

LASER MACHINE

Operation Manual

Model: Saturn II

Address: 21 Blue Sky Court, Sacramento CA 95828

Phone: (916) 383- 8166

Email: contactus@lightobject.com



Read and understand operation manual before using this machine.

Failure to follow operating instructions could result in death or serious injury.

Table of Contents

CO ₂ Laser Safety & Policies	4
Fire & Hazardous Materials	5
Accessories	6
First Time Laser Setup	8
Unpacking and Setting up the Machine	9
Installing Other Accessories	14
Connecting Laser Machine to Computer	16
Sending files to your Laser Machine	21
Power control	22
Control Panel Keypad	23
Focusing the Lens	26
Using with Rotary	29
Maintenance	30
Troubleshooting	31

CO₂ Laser Safety & Policies

WARNING: The safety precautions below are mandatory guidelines that must be followed. LightObject will not be held responsible for damages or injuries resulting from improper use of the laser machine.

DO NOT operate the laser machine until you have been properly trained.

DO NOT make contact with any exposed wires on the machine.

DO NOT use any unapproved or unsafe materials such as Polyvinyl Chloride (PVC) which emits noxious gases that can harm your central nervous system.

DO NOT operate the laser near flammable/explosive substances.

DO NOT engrave on shiny metal or mirror as the laser beam can be reflected and deviate that may result in blindness or burn.

NEVER look directly at the laser while in operation and avoid exposure to laser.

NEVER set anything on top of the laser and/or on the worktable when not in use.

NEVER leave the laser machine running while unattended. Monitor the machine when it is running at all times to be able to hear and observe abnormalities and potential hazards.

NEVER push or pull on the laser head housing or gantry while the laser is running.

NEVER dismantle the laser machine as there are laser and high voltage parts that could harm or result in injury.

NEVER open the upper cover of the laser machine while it is running.

ALWAYS wear proper goggles during machine operation.

ALWAYS unplug the machine before making any further adjustments.

ALWAYS keep hands away from machine while operating and stand clear from laser tube area.

In Case of an Emergency:

TURN OFF the POWER SWITCH of the machine OR
Press the EMERGENCYSTOP button

Fire & Hazardous Materials

WARNING: Leaving the machine unattended while in use can result in a fire and substantial damage to the machine and the building it resides in. Any damage caused by fire that is not due to defects in workmanship or the machine itself will NOT be covered by the LightObject warranty.

Hazardous Materials: Any materials considered hazardous are NOT recommended to etch, cut or engrave. These materials can produce toxic fumes or cause the machine to not function properly.

Materials that should NOT be used on the machine:

Polycarbonate

PVC Compounds

Vinyl

Fumes produced by above materials can cause irritation to eyes, skin and the respiratory tract. This material should not be exposed to elevated temperatures.

Laser Safe Materials:

Acrylic, Wood, Leather, Plastics (ABS, POM, Polyimide, PP, Styrene), Fabric, MDF, Cardboard, Paper, Foam, Fiberglass, rubber, Steel

Accessories

Air Exhaust Fan
(optional)



Tool Box with
hand tools
(photo for
reference only)



Air Exhaust Hose
(6" dia.)



Exhaust Hose
Clamps



Tubing for Water
Chiller



Laser Tube




Water Chiller
(sold separately)



Air Pump



Light adjuster

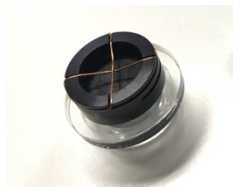

Pressure reducer
regulator
gas meter
pressure gauge
(sold separately)



3rd Mirror
Light adjuster



Other accessories

- 1) Ethernet Network LAN cable
- 2) USB cable
- 3) Laser cutting head tips
- 4) Cotton tipped sticks (for cleaning lens with alcohol)
- 5) Other tools for adjustment

First Time Laser Setup

The following components are required for operating the laser machine:

Air Assist: to blow smoke away from the beam, preventing damage to the lens and preventing burning the material.

Water Chiller: to circulate cool water into the laser tube to prevent the tube from overheating. The laser tube needs to be at a cool temperature of 15°C - 25°C or else the laser tube may overheat and potentially crack.

Silicone Tubing for Water Chiller and Air Pump: 2(4) hoses to transfer water for cooling of the laser tube(s) and 1 hose to blow air around the laser head.


Air Exhaust Hose and Air Exhaust Fan: to provide ventilation removing fumes from laser machine.

Unpacking and Setting Up the Machine


- 1) Uncrate the laser machine.



- 2) Open up the laser machine and retrieve all accessories that may be inside the machine when shipped.
- 3) Once all of the accessories have been removed, you are now ready to begin setting up the machine.
- 4) Place the laser tube on the laser tube mounts.

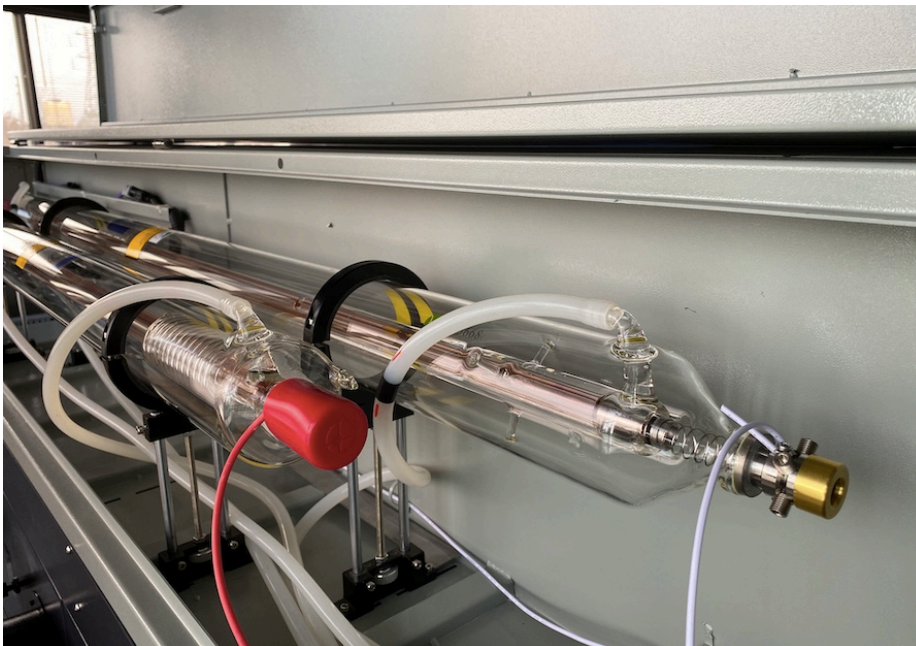

- 5) Connect the water tubing to the laser tube(s).

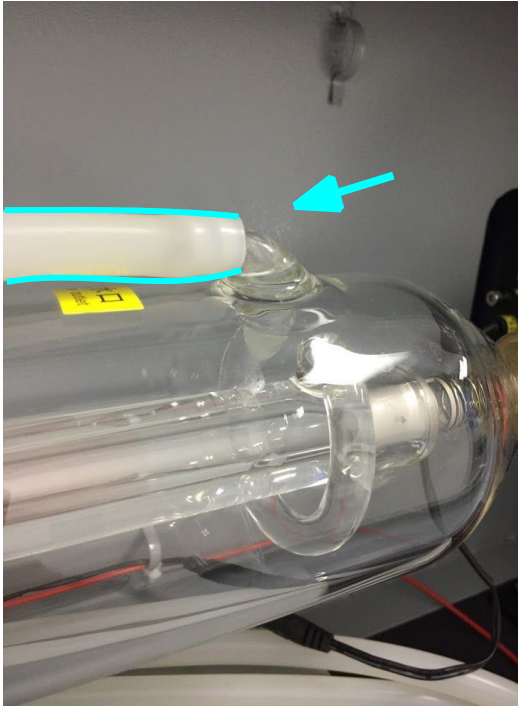


- 6) Be sure to connect the silicone tubing on both sides of the laser tube. Connect water tubing between chiller and machine. Chiller's outlet goes to machine's inlet. Machine's outlet goes to Chiller's inlet. The correct direction of water flow is from high voltage side (red wire) of the laser tube to the low voltage side.



(Chiller's back side for reference only)


Note: The water temperature should always be between 59-77 degrees Fahrenheit when running the machine. (15-25 Degrees Celsius). Some default temperature setting of water chiller is 22 or 25 degrees Celsius.

- 7) Fill up the water chiller with distilled water and power up, observe the water flow direction. Switch the input/output if it is wrong.
- 8) Check air bubble trapped in the laser tube. **Squeeze the water tubing or tilt the laser tube carefully to get rid of the big bubble.** Small bubbles are acceptable.

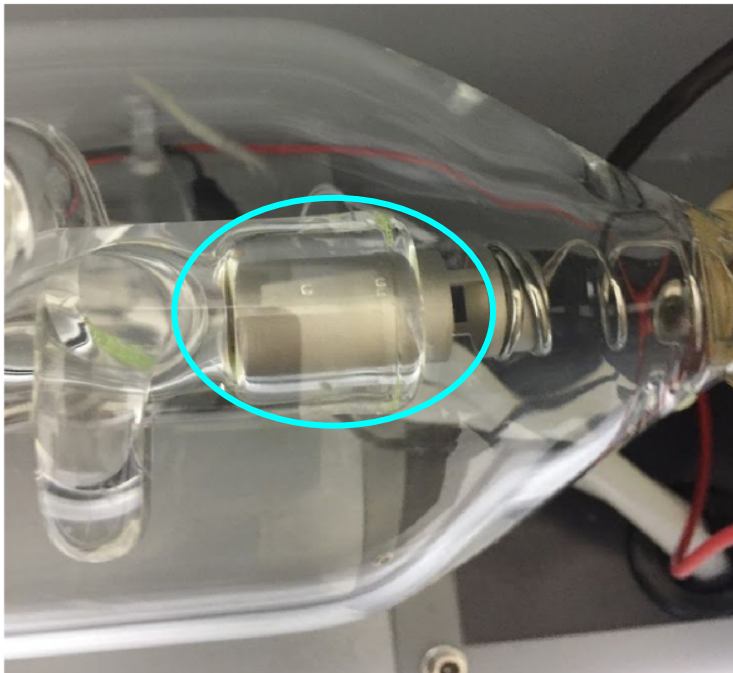


IMPORTANT: The tube can overheat quickly if large bubbles are present when the laser is firing which can cause the tube to crack.

- 9) Secure the laser tube on the laser tube mounts. Make sure the laser tube is horizontal by checking with a level.

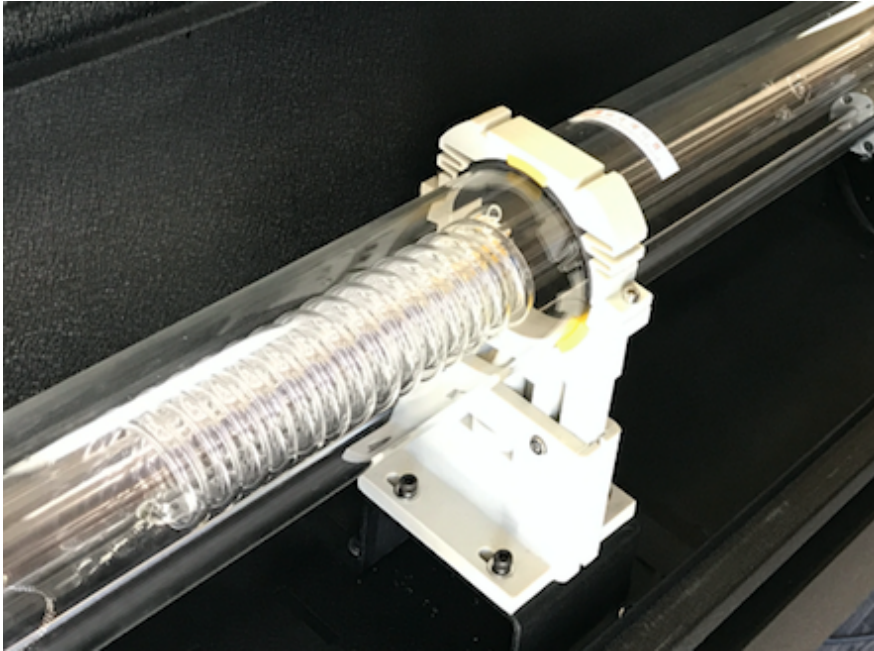


- 10) For screw type connection, clamp the wire under the screw. Put the rubber cap back on the tube on the high voltage side if available.

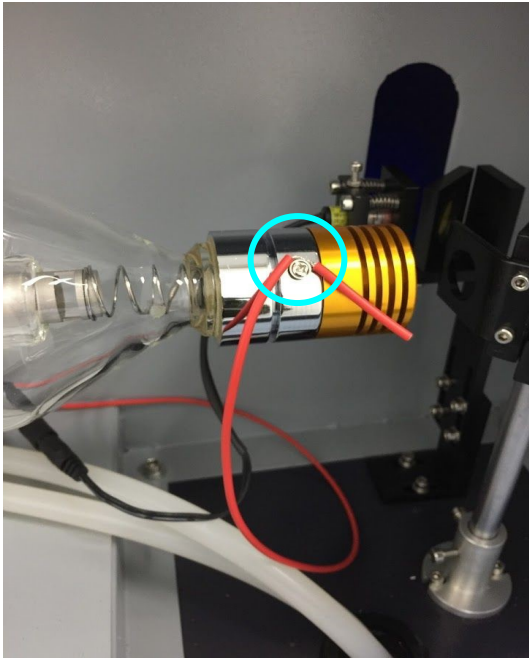

OR

For wire type connection, make a twist like a hook and clamp the hook under the screw.

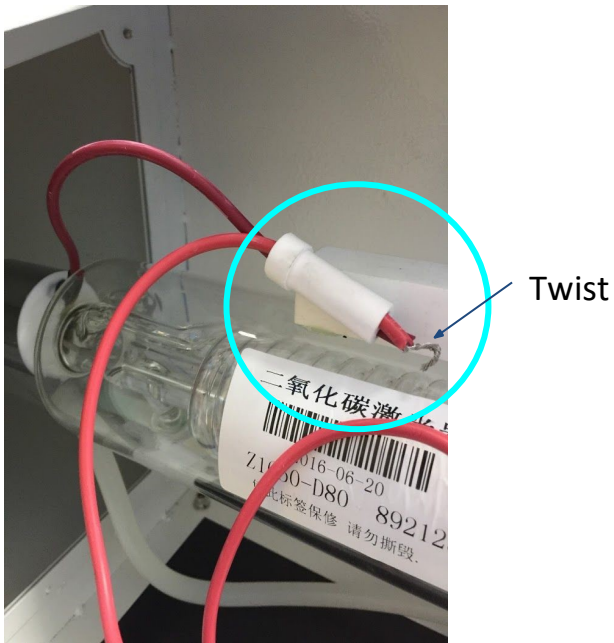

OR

Wrap the wire around the tube's metal pin. Fix the connection by proper soldering OR applying silicon glue. Make sure to shield it with a piece of silicone tubing to prevent arcing.



- 11) Turn on the power by turning the main switch to the ON position
- 12) Release the EMERGENCY STOP button.
- 13) Press the machine "POWER" button. The laser power buttons can be pressed later, when it is time to fire up the laser.

Installing Other Accessories

Exhaust Fan Installation

Some materials such as leather or wood generate larger amounts of smoke than other materials. The exhaust is necessary to remove harmful fumes and smoke. The exhaust must be ducted to the outside and away from any area where animals or humans congregate.

Connect the air exhaust hose by using the hose ring clamps provided, connecting the exhaust hose is done in the rear or underneath (varies based on machine). See picture below.



Turn the exhaust fan on when doing any cutting and engraving to remove the smoke and fumes.

Note: Avoid excessive length, kinks and turns when installing the exhaust pipe/hose.

Air Assist

Connect the air pump to the laser machine air input. Turn on the air before doing any cutting or engraving to prevent any clouding on the lens and to prevent the material from burning

CO2 metal cutter model come with high pressure tubing to enable easy upgrades for larger air compressor. An air pressure regulator is used along with an air compressor to adjust the air flow from your compressor to your laser machine.

O2 should be used for cutting METAL. Air pressure should be adjusted to 80 - 90 PSI
COMPRESSED AIR – for cutting NON-METAL
AIR – for cutting NON-METAL


Pressure reducer
regulator gas meter
pressure gauge
(sold separately)



Reminder: ALWAYS MAKE SURE OXYGEN IS ON FOR METAL CUTTING; PLEASE REFER TO CONTROLLER MANUAL TO SET THE AIR ASSIST WITH OXYGEN, AIR OR NITROGEN

Example:

With Trocen TF6225, press "1" which is the shortcut key to go to the technological Parameters to change from Air to Oxygen shown below.

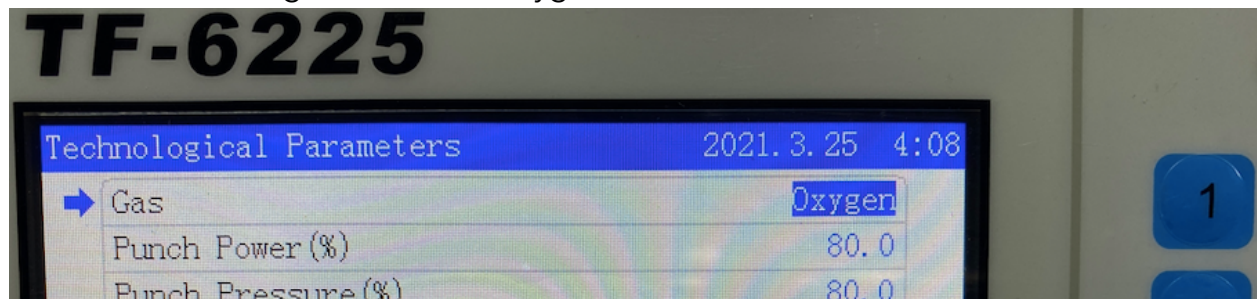

Air Pump / Air Compressor

The Air Pump or Air Compressor are used to blow air through the laser head. This will blow away debris and smoke from the laser beam while allowing for a cleaner cut and protecting the lens.

The air compressor on/off switch should be close by and preferably on the same circuit as the water chiller and exhaust fan to ensure it is in operation while running the laser machine.

Connecting Laser Machine to Computer

The laser machine with Ruida controller (e.g. RDC6332G) can work with below software


- a) MetalCut (for Windows only)
- b) RDWorks (for Windows only)
- c) LightBurn (for Mac and Windows)

The laser machine with Trocen controller (e.g. TF-6225) can work with below software

- a) LaserCAD (for Windows only)
- b) LightBurn (for Mac and Windows)

Set up with MetalCut

- 1) Install the software MetalCut
- 2) Connect the USB cable.
- 3) Under "Device". It should show the device is connected with "USB:Auto".

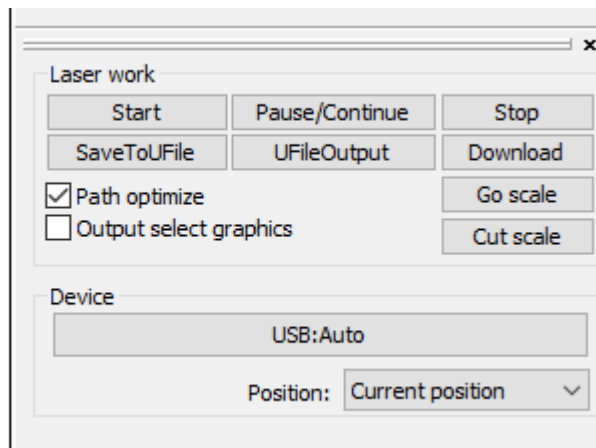

Note: If you have multiple windows opened (e.g. LightBurn windows), there could be issue on connection. Therefore, open one window at a time


- 4) Cutting metal
 - a) When your drawing is ready, please click on "Cut In/Out" to configure the "Cut in and out setting". Then, check "Enable" and enter the Length and Angle. Then, click "Ok".
 - b) Go to "User" tab in the menu on the right hand side. Set "Mixcut parameters" by setting "Enable pulse punch" to "Yes"

Cutting non-metal

- a) There is no need to enable "Cut In/Out".
- b) Go to "User" tab in the menu on the right hand side. Set "Mixcut parameters" by setting "Enable pulse punch" to "No".

Set up with RDworks


- 1) Download and install the software RDWorks from <http://www.rd-ac.com/>
- 2) Connect the USB cable.
- 3) Click on "Setting" in Device. It should show the device is connected.


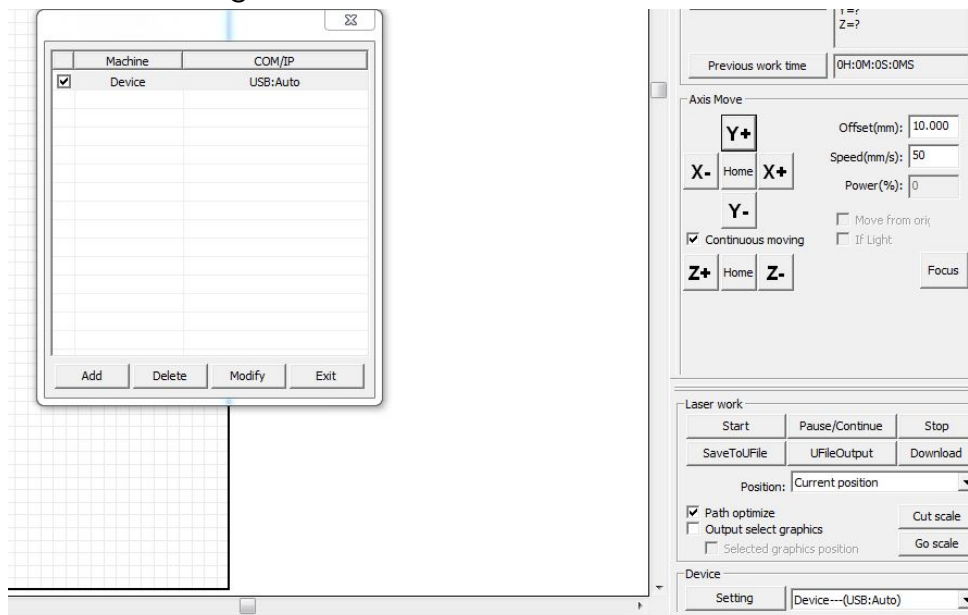


Set up with LightBurn

- 1) Download and install the software LightBurn from <https://lightburnsoftware.com/>
- 2) Connect the USB cable.

- 3) Follow the instruction from the screen, and it will guide you connecting the computer to the laser machine.

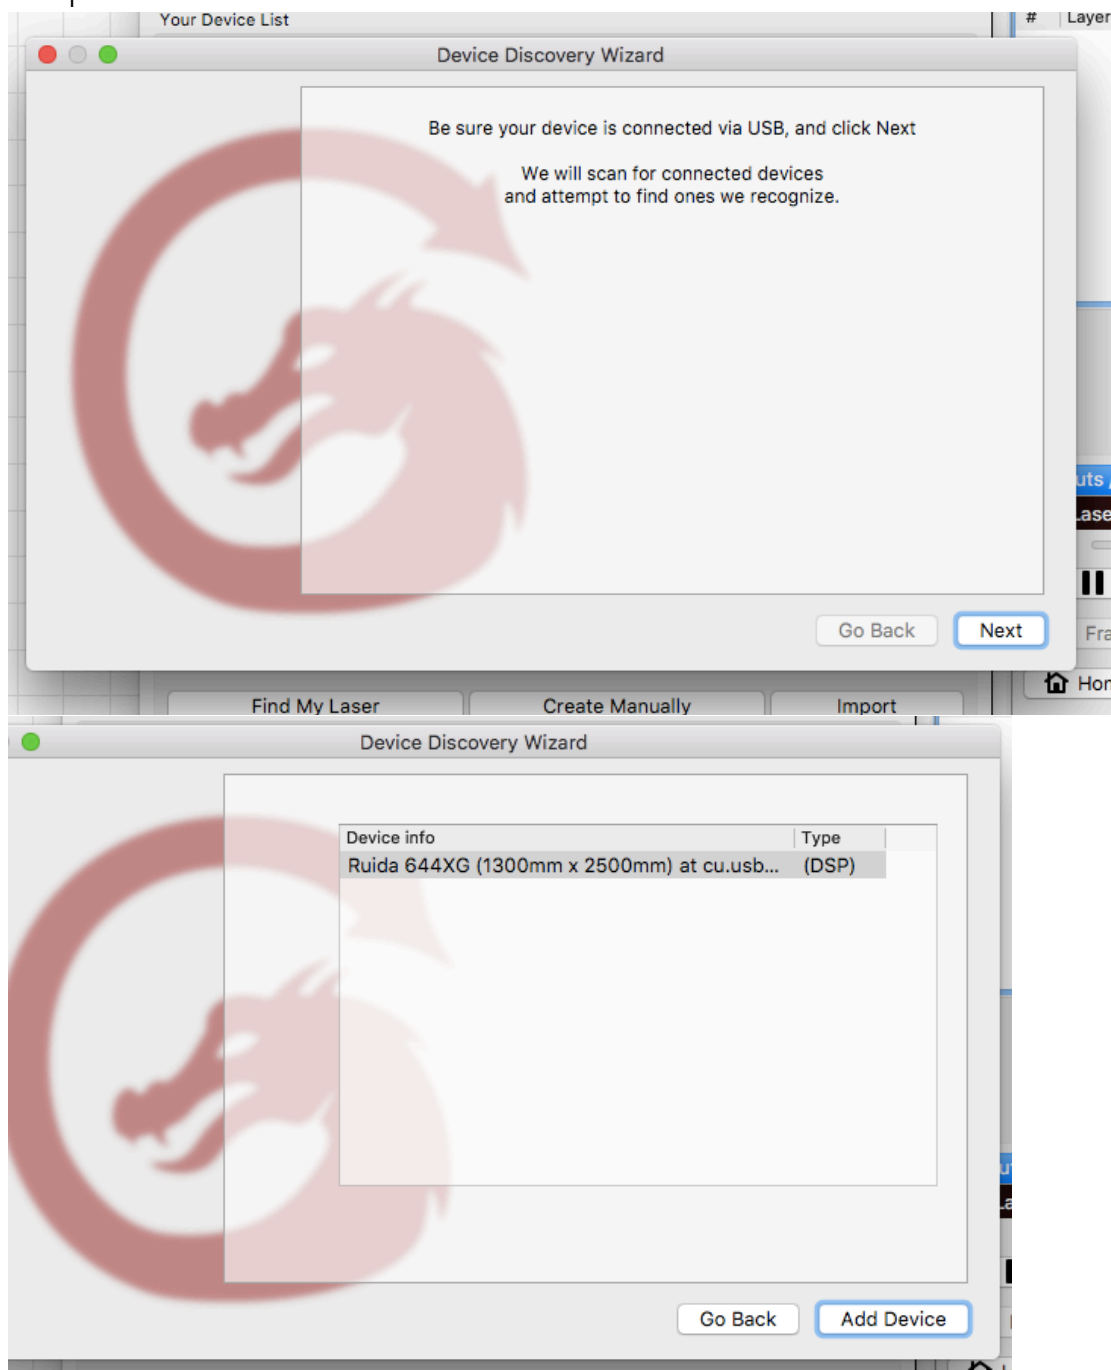

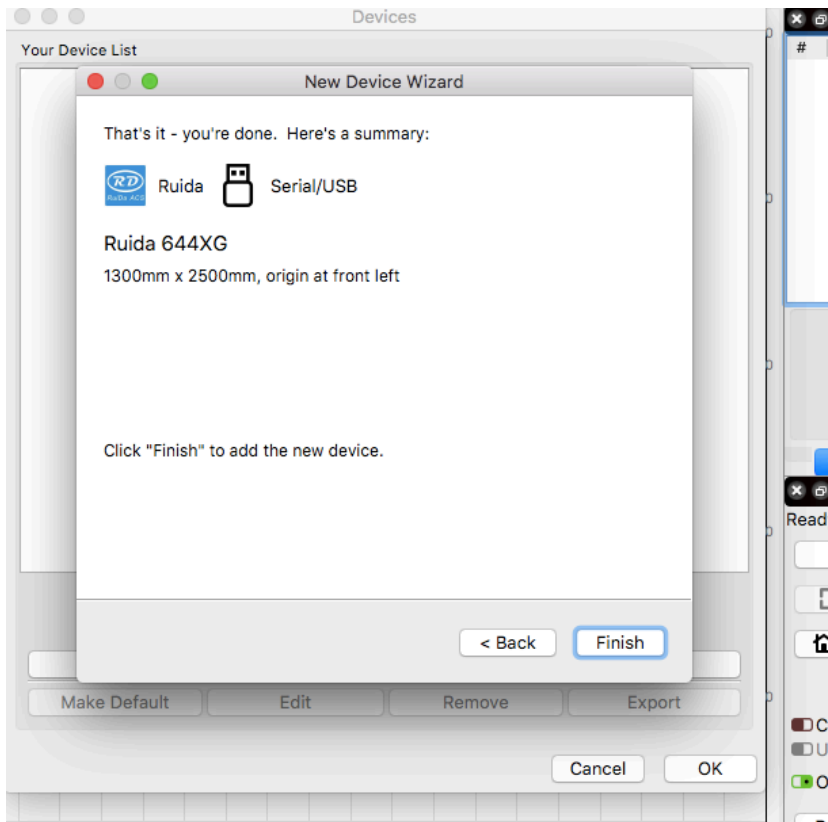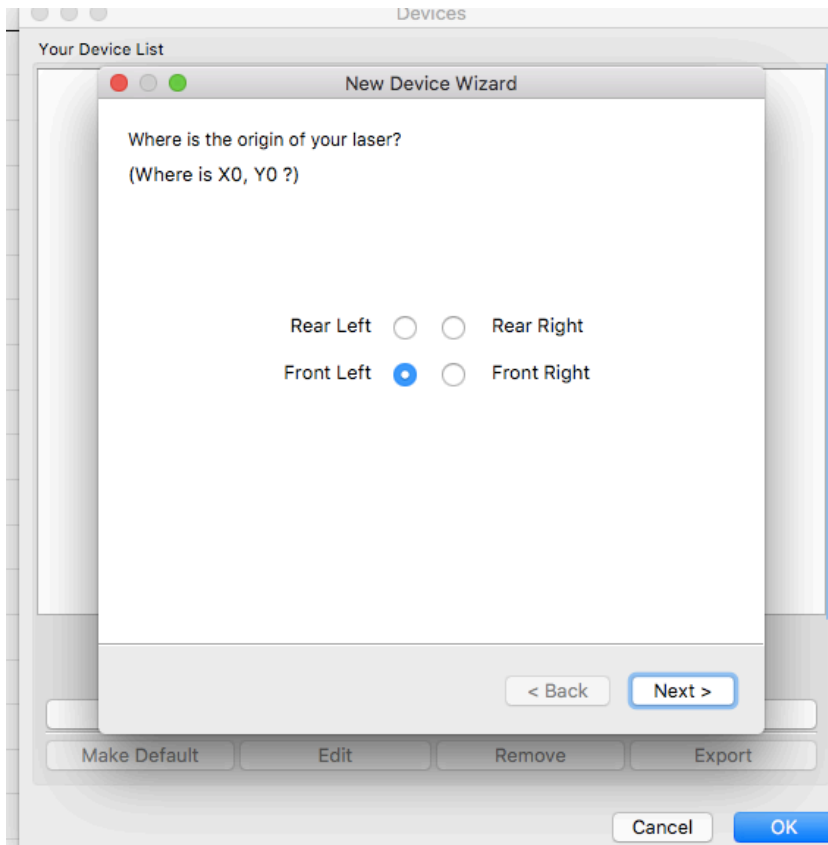


NOTE: Please refer LightBurn instruction manual and tutorials in their site for configuration and usage

If you are using LAN connection, input the same IP address set on the laser controller.

NOTE: Please make sure LAN cable is connected between computer and laser machine.

4) Click "Devices". Follow the steps given by LightBurn.

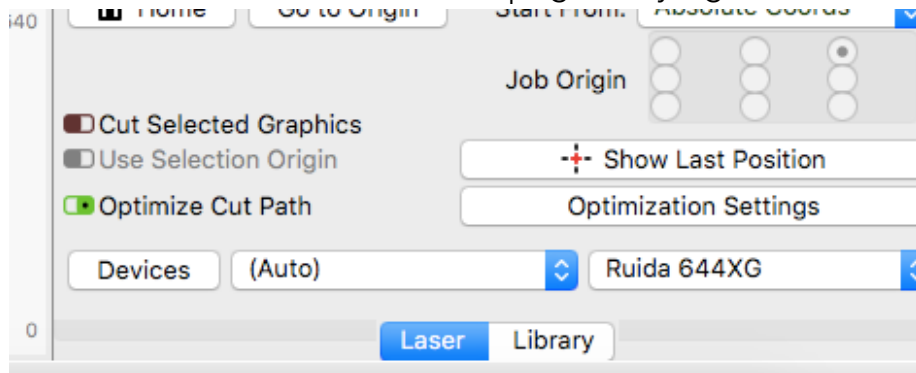

OR Click "Create Manually" (if "Auto detect" does not find the machine)

- 5) Select e.g. Ruida" / "Trocen" in New Device Wizard", click "Next"
- 6) Choose "Ethernet/UDP"
- 7) Input the IP address you have seen in the DSP control panel e.g.169.254.169.041
- 8) Input the Name you would like to call it
- 9) Input the dimensions of the work area e.g. 1300mm for the width, 2500mm for the height
- 10) Select the origin, then click "Next"
- 11) It will show the setting, then click "Finish"

Sending files to your Laser Machine

Once you have established the connection between the computer and the laser machine, job files can be transferred.

To do this, click on the Sent button(LightBurn) OR Download button(RDWorks/LaserCAD) located on the right side of the laser software.

Alternatively, save the file as UFile and put in a USB stick. Then download the file from the USB stick on the laser control panel.

Power Control



Power -> To turn the machine on / off

Laser 1 - > Laser tube 1 main switch (e.g. 130W laser tube with hybrid laser head)

Laser 2 -> Laser tube 2 main switch (e.g. 80W laser tube with non-metal laser head)

Current control knob 1 -> Adjust output current for the laser tube 1

Current control knob 2 -> Adjust output current for the laser tube 2

Control Panel Keypad

Note: Since the laser cutter can be connected to different controllers and system (e.g. Ruida RDC6332G), please always refer to the controller manuals for details.

Functions of typical keypad (e.g. TF-6225):



Reset: No matter what the state of the machine is in, pressing this button will make it enter the resetting state.

Follow ON/OFF: Switch follow function ON or OFF. (ON – for tracking metal when cutting; OFF – for non-metal cutting)

Menu: The main menu which user can do all setting

File: Browse the files stored in the control board.

Shift: Use with function keys

Laser: Pulses the laser beam

Box: Frames the working area from the origin point of the current file.

Origin: Select the starting point of your file within the work table.

Stop: Once pressed, the machine will stop its current function and move back to its origin. **Press 【Stop】 + up / down arrow buttons next to the number buttons to control Z-table movement (if applicable).**

Start/Pause: Pause the machine and keep it stay at location. Press again to resume.

Enter: Validate the choice or change. **It can also be used to change the top menu setting including (File, Speed, Power, Pressure, Track Height) by pressing it once.**

Arrow keys: Move the laser head to X/Y axis

Hand: Change the speed switching (fast/slow) of moving axis manually.

Esc: Stop the current work that the machine is doing or to exit the current menu

Functions of typical keypad (e.g. RDC6332G):

Reset: Refresh the system and will stop all running applications and return to the main interface.

Start/Pause: Start or Pause the current work on the laser

Stop: Stop all running applications

Origin: Select the starting point of your file within the work table.

Pulse: Pulses the laser beam

Frame: Show you the framed area of which your file will run in

File: Show the management of the memory Sending files to your Laser Machine

and Udisk files

Speed: Set the speed of the current running layer, or to set the direction keys' move speed

Max. Power: Set the maximum laser power of the current running layer or set the power of the "Pulse" key

Min. Power: Set the minimum laser power of the current running layer

Left & Right Arrow: Move the X-axis of the left/right cursor

Up & Down Arrow: Move the Y-axis or the up/down cursor

Z+ & Z-: Move the Z-axis

Home: The Home key can be pressed when the system is idle, or the work is finished. Each Axis goes home

Esc: Stop the current work that the machine is doing or to exit the current menu

Enter: Validate the choice or change.

Diagnose: Diagnose the system such as the limiter status, water protect etc.


Focusing the Lens

(If the machine come with Ruida Hybrid controller e.g. RDC6332G)


(For non-metal cutting) Manual Focus:

The lens should be adjusted and focused according to the thickness and type of material.

To adjust the focus, adjust the height to accommodate the thickness of the material by pressing the up and down arrow

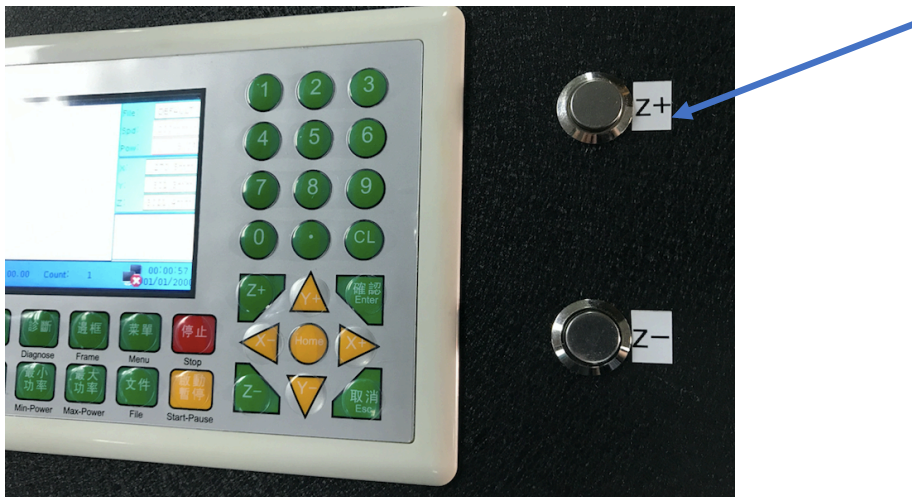

(Photo is for reference only; Different models of controller look different)

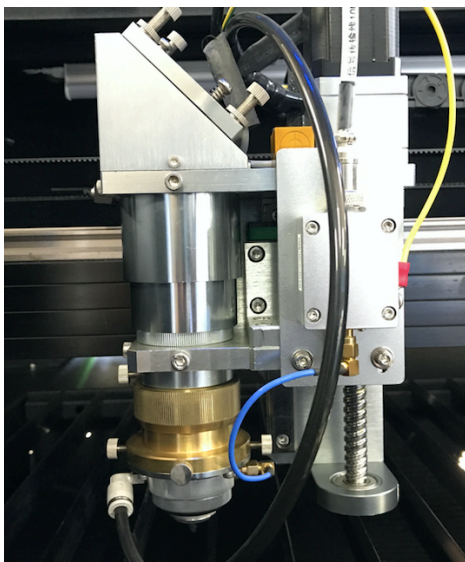

Do some cuttings on the material, and try to find the smallest burn on the material by adjusting the height of the tip. The smallest burn with the specific height of cutting head you find on the material means it is focused.

OR

You may do a ramp test. Put a piece of wood at an angle like a ramp. Laser cut a line across it. Move the laser head over the narrowest section of burn mark. The gap between the tip and the material is the focus height.

Laser tip:

For cutting Non-metal: Always use non-metal tips

For cutting metal: Always use metal tips

(For metal cutting only) Auto-Focus:

- 1) Enable metal cutting mode by pressing "Metal and non-metal cutting mode transfer switch". Both green switches will light up.
- 2) Place the metal sheet you want to cut on the bed. Move cutting head above the metal.
- 3) Press "Automatically search the focal" button for auto calibration.

Warning: During the calibration process, please make sure the tip does not crash the metal sheet. If it does, press the Emergency button to Stop the operation.

The machine will stop. You can just simply restart the machine by moving the laser head up, check and adjust the metal sheet and try to do the calibration again.

(If the machine come with Trocen Hybrid controller e.g. TF-6225)

(For non-metal cutting) Manual Focus:

The lens should be adjusted and focused according to the thickness and type of material.

To adjust the focus, adjust the height to accommodate the thickness of the material by pressing the up and down arrow keys (next to number keys)

Do some cuttings on the material, and try to find the smallest burn on the material by adjusting the height of the tip. The smallest burn with the specific height of cutting head you find on the material means it is focused.

OR

You may do a ramp test. Put a piece of wood at an angle like a ramp. Laser cut a line across it. Move the laser head over the narrowest section of burn mark. The gap between the tip and the material is the focus height.

Laser tip:

For cutting Non-metal: Always use non-metal tips

For cutting metal: Always use metal tips

(For metal cutting only) Auto-Focus:

- 1) Enable metal cutting mode by pressing "Follow ON/OFF" button to enable Tracking function
- 2) Place the metal sheet you want to cut on the bed. Move cutting head above the metal.
- 3) Press Menu.
- 4) Select Height Control Parameters

Select Floating head Calibration. Then, Calibration process will start. Once it is finished, it is ready to cut metal with calibrated distance data just taken.

Warning: During the calibration process, please make sure the tip does not crash the metal sheet. If it does, press the Emergency button to Stop the operation. The machine will stop. You can just simply restart the machine by moving the laser head up, check and adjust the metal sheet and try to do the calibration again.

Using with Rotary

The Hybrid system must have following to operate properly when using the Rotary.

When enabling rotary, you will lose movement on your Y-axis(ability to move your gantry up and down) so before starting to makes rotary changes move the gantry on the Y-axis to the desired position.

(ONLY If rotary stepper driver(rotary function) is not included when the machine is delivered)

You have to manually connect the rotary stepper driver to the controller. On the side of the CO2 Hybrid unit, next to the laser controller or power switch open up the panel with the key provided in the accessory box and take a look. There will be a stepper driver that is not plugged in into anything. This stepper driver is used to drive the rotary motor. All you do is grab the connection and connect it to the Y-connection port on the DSP control board. The Y-connection should be clearly labeled, unplug the Y and plug your rotary connection in.

To use rotary, you need to enable rotary on the controller and the machine.

- a) Press "Rotation axis" button near the Main Power switch to enable rotary .
- b) On the controller, It should be under Main Menu / Common Parameters / Rotary Engraving & Cutting. Change to "Enable" . See controller instruction manual for details.

When enabling rotary, please RESTART CO2 Hybrid unit to have rotary setting take effect.

When done using your rotary, unplug your rotary connection from the DSP and connect the Y connection back in. (ONLY If rotary stepper driver(rotary function) is not included when the machine is delivered

Make sure you disable rotary on the controller and press the "Rotary axis" to disable the function. Then, restart the CO2 Hybrid unit for the changes to revert back to normality.

Maintenance


Cooling:

Automotive antifreeze should not be used as a laser coolant. Distilled water shall be used. The coolant should always be clean and clear.

Focal lens:

This is the lens that is used to focus the laser beam. This lens should be cleaned at least once per week. It is not possible to clean the lens while it is mounted in the focal tube. The laser beam alignment should be checked after cleaning is completed. If there is any incident of fire or large issue of smoke/fumes, then it is advised to check the lens and clean it. Use denatured alcohol and/or acetone as the cleaning solvent. Use a lens tissue or cotton tipped swabs.

The focal lens should be replaced if it is cracked, the coating is scratched/pitted, the core material is darkened, the coating is delaminating, or any other significant damage is found.

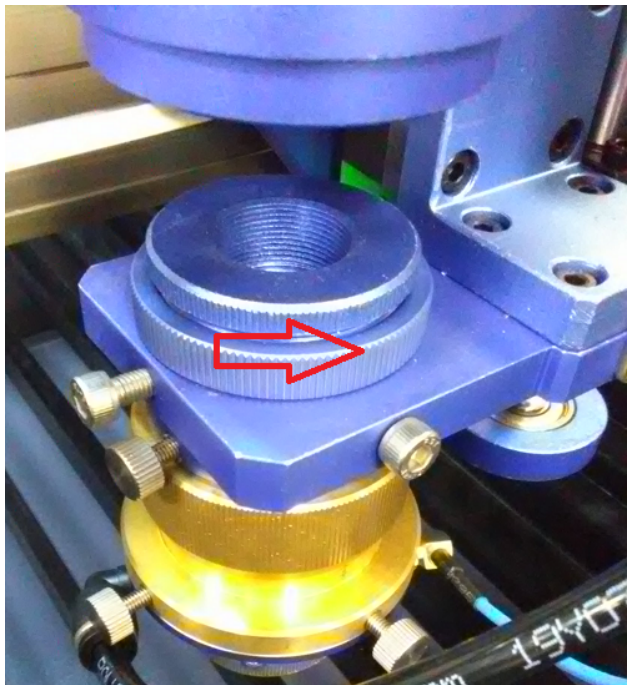

To remove the lens, jog down the laser head to have enough space. Rotate out the right-hand thread barrel as shown in the picture. The female thread above the red arrow is for securing long focal length lens.

Mirror:

This mirror should be cleaned at least every three months.

Laser Alignment:

WARNING: DO NOT obstruct the path of the laser, beam is invisible!

NOTE: Due to transportation, the alignment may be off.

- 1) To make sure that the laser is properly aligned, place an adhesive note around the alignment housing next to the mirror.
- 2) Set the laser power low to avoid burning the paper.
- 3) Start with the first mirror; press the laser button once. If that mirror is aligned correctly, the burned mark should be in the center of the circle on the housing. If it is not aligned, then the three screws for each mirror must be adjusted little by little until the laser hits the center. Test after each adjustment.
- 4) Once the first mirror is done, repeat the steps to align the 2nd mirror.
- 5) When mirrors are aligned correctly, the mark will be in the center regardless of the x and y position (wherever the laser head moves).

Troubleshooting

The machine does not turn on:

Make sure to check below

1. Does the power supply function properly?
2. Is the emergency button pressed?
3. Is the power switch turned to the on position?

Laser does not fire:

Make sure to check below

1. Check if the water chiller functions properly
2. All doors are closed

Autofocus reading is incorrect:

Check all wiring connection on laser head are not loose.

Clean the nozzle tip.

The ceramic part above the nozzle may need replacement.